



Technical Service Information Bulletin

July 25, 2006

Title:

VOICE COMMANDS FOR CLIMATE CONTROL ARE INOPERATIVE

Models:

'07 ES 350

ELECTRICAL
EL008-06

Introduction On 2007 model year ES 350 vehicles equipped with the Lexus Navigation System, some customers may experience a condition where the climate control voice recognition commands are inoperative. An updated multi-display has been developed to resolve this condition.

- Applicable Vehicles**
- **2007** model year **ES 350** vehicles equipped with the **Lexus Navigation System** produced **BEFORE** the Production Change Effective VIN shown below.

**Production
Change
Information**

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
ES 350	JTHBJ46G#72022076

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
86430-33010	Same	Multi-display Assembly	1

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
866101	R & R Multi-display Assembly	0.6	86430-33010	72	74

Applicable Warranty*:

 
 
This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



Required
SSTs

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	Plastic Pry Tool Set*	00002-06000-01	1	20
COMPONENT(S) OF KIT/SET	NOTE: • All components from this kit/set are required. • Plastic Panel Clip Removal Tool (P/N 00002-06001-01) • Plastic Emblem Removal Tool (P/N 00002-06002-01)			



* Essential SSTs.

** Refers to drawer number in SST Storage System.

NOTE:

Additional SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.

Repair
Procedure

1. Order a replacement multi-display through the Fujitsu-Ten exchange program.

NOTE:

Refer to the Lexus Customer Services Web site on Dealer Daily for ordering information for the exchange program.

2. Replace the multi-display.
Refer to the Technical Information System (TIS), 2007 model year ES 350 Repair Manual: *Navigation: Multi-display:Removal, Installation*.
3. Start the engine and wait 10 seconds.
4. Turn the ignition OFF and wait 1 minute.
5. Start the engine again.
6. Confirm the climate control voice commands are functional.