



## Technical Service Information Bulletin

June 28, 2006

Title:

# EXCESSIVE ENGINE NOISE AFTER TRANSAXLE REMOVAL

Models:

'07 ES 350


ENGINE  
EG016-06

**Introduction** Some 2007 model year ES 350 vehicles may exhibit engine noise after the transaxle is removed and reinstalled. This noise may be caused by a dislodged steering column hole shield at the base of the steering column.

**Applicable Vehicles**

- 2007 model year **ES 350** vehicles.

**Inspection Procedure** Inspect the steering column hole shield to ensure that it is properly seated and that the clamp is securely fastened.

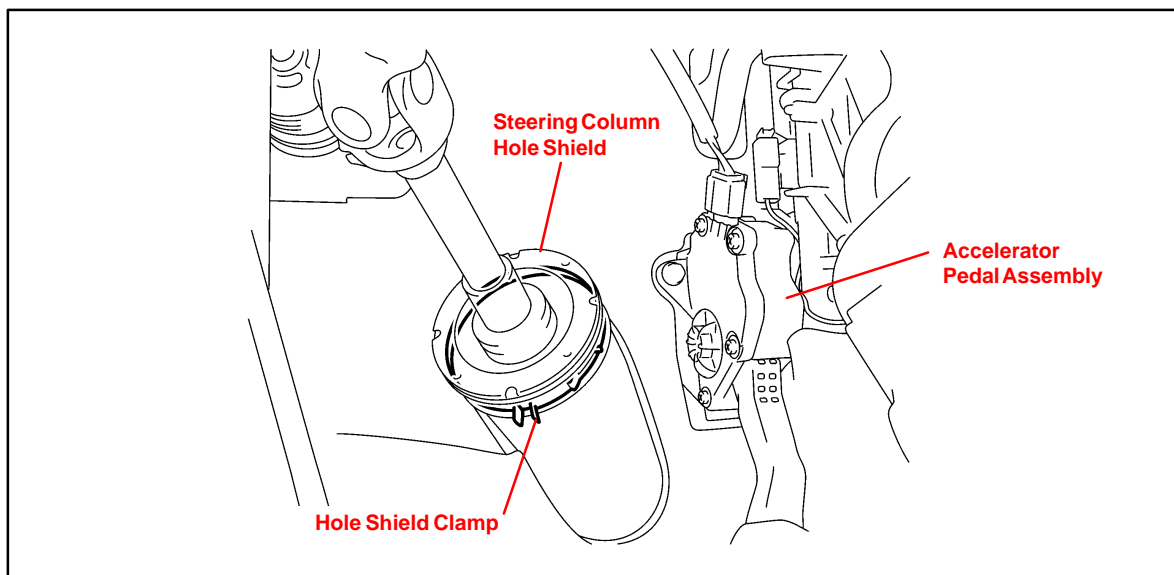

### Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
N/A	Not Applicable to Warranty	—	—	—	—



Lexus Supports ASE Certification